

/ Outside Humidity Temperature Transmitter

HTOS Series - Installation Instructions

INTRODUCTION

The outside humidity/temperature transmitter series uses a highly accurate and reliable Thermoset Polymer based capacitance humidity sensor and Platinum RTD temperature sensor together with state-of-the-art digital linearization and temperature compensated circuitry to monitor humidity levels. A hinged, gasketed weatherproof Polycarbonate enclosure provides ease of installation and protection from the elements.

BEFORE INSTALLATION


Read these instructions carefully before installing and commissioning the humidity/temperature transmitter. Failure to follow these instructions may result in product damage. Do not use in an explosive or hazardous environment, with combustible or flammable gases, as a safety or emergency stop device or in any other application where failure of the product could result in personal injury. Take electrostatic discharge precautions during installation and do not exceed the device ratings.

MOUNTING

Select a suitable mounting spot on an exterior wall where the sensor is best protected from direct exposure to sunlight, wind, etc. preferably on a north facing wall. Do not mount the sensor near opening windows, supply/exhaust air louvres or other known air disturbances. Avoid areas where the sensor is exposed to vibrations or rapid temperature changes.


The humidity/temperature transmitter enclosure provides a connection hole for 1/2" Conduit. Run a length of conduit through exterior wall and seal. Use 14-22 AWG shielded wiring for all connections and do not locate the device

wires in the same conduit with wiring used to supply inductive loads such as motors. Make all connections in accordance with national and local codes.

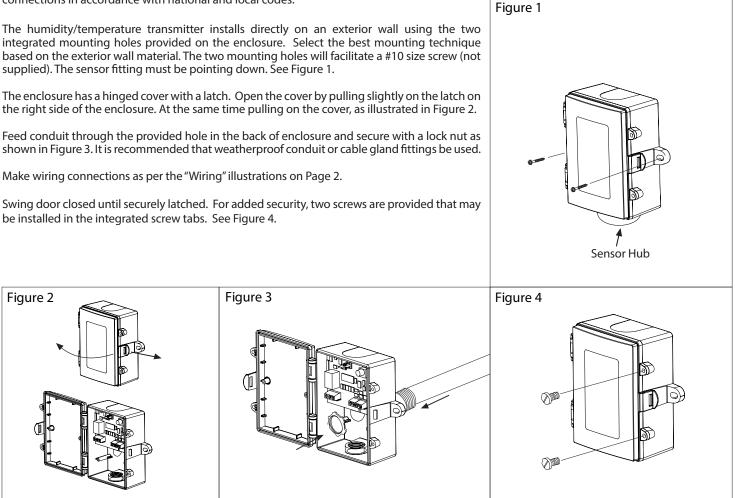

WIRING


- Deactivate the 24 Vac/dc power supply until all connections are made to the device to prevent electrical shock or equipment damage.
- Use 14-22 AWG shielded wiring for all connections and do not locate the device wires in the same conduit with wiring used to supply inductive loads such as motors. Make all connections in accordance with national and local codes.
- Pull at least six inches of wire into the enclosure, then complete the wiring connection according to the wiring diagram for the applicable power supply and output signal type.
- Connect the plus DC or the AC voltage hot side to the PWR terminal. For voltage output or AC power, the supply Common is connected to the COM terminal. The device is reverse voltage protected and will not operate if connected backwards. It has a half-wave power supply so the supply Common is the same as the signal Common. See Figure 5.
- The analog outputs are designated as TEMP and RH by each terminal. Check the controller Analog Input to determine the proper connection before applying power. See Figure 5.

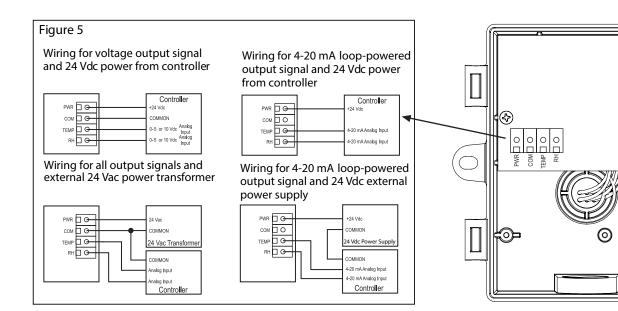

SPECIFICATIONS:

Humidity Sensor Type	Thermoset Polymer based capacitive
Accuracy	±1% (20 to 80% RH) or ±2% (5 to 95 % RH)
Measurement Range	0 to 100% RH
Hysteresis	±1.5% RH maximum
Repeatability	±0.5% RH typical
Linearity	±0.5% RH typical
Sensor Response Time	15 seconds typical
Stability	±1% RH typical at 50% RH in 5 yrs.
Temperature Sensor Type	1000Ω Platinum, IEC 751,
	385 Alpha, thin film
Sensor Accuracy	±0.1% of span
Operating Temperature	40° to 85°C (-40° to 185°F)
Operating Humidity	0 to 95% RH non-condensing
Power Supply	18 to 35 Vdc, 15 to 26 Vac
Consumption	22 mA maximum
Input Voltage Effect	Negligible over specified operating range
Protection Circuitry	Reverse voltage protected & output limited
Output Signals	4-20 mA, 0-5 or 0-10 Vdc
Output Drive at 24 Vdc	550 ohms max for current output,
	10K ohms min for voltage output
Internal Adjustments	Clearly marked ZERO and SPAN pots
Wiring Connections	Screw terminal block (14 to 22 AWG)
Enclosures	Grey polycarbonate with gasket, UL94-V0 IP65
	117 W x 102 H x 53 D mm (4.6" x 4.0" x 2.1")
Weight	220g (7.8 oz) including Probe.
Country of Origin	Canada
TEMPERATURE SENSOR OPTIONS	
Sensor Type	Platinum RTD 1000 Ω, 385 Alpha @ 0°C
Accuracy	RTD Class A: ±0.15°C @ 0°C
-	RTD 1/3 DIN: ±0.1°C @ 0°C
	RTD 1/10 DIN: ±0.03°C @ 0°C

DIMENSIONS

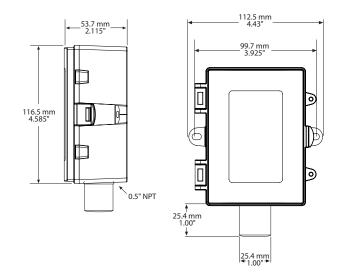

0

0

 \langle